



Nothing else measures up!

Follow us!



Prospect House
George Cayley Drive
Clifton Moor
York
England
YO30 4XE

Tel: +44 (0) 1904 692723
Fax: +44 (0) 1904 690385

E-Mail: sales@yorksurvey.co.uk



Protimeter Digital Mini



Code: 354790

Operating Instructions

Protimeter DigitalMini Moisture Meter

1. Safety Considerations

Caution note for the WME pins - The Pin Moisture measurement pins are extremely sharp and the instrument should be handled with due care. The pins should be covered with the cap provided with the unit when the function is not in use.

Calibration of unit - The accuracy specifications of the product are valid for one year after the date of calibration and the product requires recalibration after this period.

Only operate the measuring instrument properly, for its intended purpose and within the parameters specified in the technical data. Readings from moisture meters are not definitive but are used to help a professional make informed judgement to the material's moisture condition. Conductive material such as salts, carbon and metal can give false positive readings.

2. Pin (WME) Mode Operation

DigitalMini uses electrical conductance principles to measure the moisture level of the material between two electrodes. The instrument has integral pin electrodes that may be firmly pressed onto surfaces, or it may be used with various auxiliary moisture probes, including Heavy Duty Pin Probe, Deep Wall Probes, a Hammer Electrode (optional) or an EIFS probe (optional).

Remove the needle cap from the top of the DigitalMini and press the ON/OFF button to switch it on.

%WME will appear in the display. Push the pins firmly onto the surface of the material at the required point of measurement. Read the moisture level value from the display and note the moisture condition of the material from the colour coded LED scale.

Note: Measurements taken in wood are actual % moisture content values, whereas readings taken in material other than wood are % Wood Moisture Equivalent (%WME) values - see Pin Mode Interpretation for more details.

3. Using Auxiliary Moisture Probes

The DigitalMini is supplied with an auxiliary plug-in moisture probe and lead for taking measurements at points that cannot be reached easily with the integral electrode pins. To use, connect the Moisture Probe jack plug to the socket on the right side of the instrument and push the probe pins onto the surface at the chosen point of measurement.

Optional Deep Wall Probes can also be used for taking readings at depth in walls and floors. To use, drill two clearance holes of diameter 6mm (1/4") roughly 40mm (1 1/2") apart to the required depth. Connect the Deep Wall Probes to the instrument and push the two probe rods into the clearance holes. Hold them firmly against the base of the holes and take the reading.

The optional Protimeter Hammer Electrode can also be used to make measurements deep into hard and softwoods.

Note: Deep Wall Probes may be used to investigate high readings. Deep Wall Probes may be used to determine the moisture profile through a structure by increasing the depth of the clearance holes incrementally.

4. Pin (%WME) Mode interpretation

Measure mode readings are precise and specific to the area of contact between the electrode tips. Actual percent moisture content (%mc) values are measured in wood products. Wood Moisture Equivalent (WME) values are measured in materials other than wood.

The WME measurement is the theoretical %mc value that would be attained by a piece of wood in moisture equilibrium with the material under investigation at the point of measurement. As the critical %mc levels of wood are known. WME values may be used directly to establish if the material is in a dry, borderline or damp condition as indicated by the colour coded LED scale.

5. Instrument Calibration Check

A calibration check device (Calcheck) is supplied with the instrument for checking the Measure mode calibration. Hold the Calcheck across the electrode pins as shown. A correctly calibrated DigitalMini will 18.2 ±1.0. Contact York Survey Supply Centre if the instrument is reading incorrectly.

6. Reference Mode

Measure the material until the meter's reading is stable then press the arrow button for 2 seconds. This will store the reading until the mode changes or the meter turns off. Now all readings taken after will be displayed as normal, but below you will see a second reading that shows you if the material is measured above or below the original reading. Reference mode can be useful when trying to establish what materials are above or below a point of reference or dry standard.

7. Operating DigitalMini

Switch On:

Press the ON/OFF button.

The unit turns on, with the LCD displaying all the segments and sweeping the LED bar graph.



Measurements:

The numeric measurement and colour LED will be shown as well as the "DRY" (green) or "AT RISK" (yellow) or "WET" (red), based on the measurement shown.

7-16.9 DRY (green), 17-19.9 AT RISK (yellow), 20-99.9 WET (red)



Reference Mode of Measurement:

Note: For application information, see Pin (WME) Mode Operation.

In Measure mode, take the first measurement which needs to be taken as reference. While the first reading is displayed on the screen, press and hold the arrow button for 2 seconds to enter the Reference mode.



To return to the normal measurement mode, press the arrow button again.

Settings:

Press and hold the arrow button and switch on the unit by pressing the ON/OFF button. Hold both the buttons until the DigitalMini displays the version.



Release both buttons while it shows the version number. The unit enters Settings mode.

DRY, AT RISK and WET Settings:

The first screen to appear in Settings is the DRY, AT RISK and WET setting screen.

This screen sets whether the indication on the display needs to be switched ON or OFF. When it is ON, the moisture condition will be displayed on the screen. When it is OFF, no indication is displayed on

the screen.



Use the arrow button to turn ON/OFF the settings.



If the unit detects no key press for 2 seconds in the Setting screen, it moves to the next setting.

Pressing the ON/OFF button, after you have entered the desired setting, will save the setting and move the screen to the next setting.

Buzzer ON/OFF Settings:

Once the DRY, AT RISK and WET settings are entered, the next setting turns the Buzzer ON or OFF.



To change the settings, press the arrow button.




If the unit detects no key press for 2 seconds in the Setting screen, it moves to the next setting.

Pressing the ON/OFF button, after you have entered the desired setting, will save the setting and move the screen to the next setting.

Backlight Settings:

Once the Buzzer settings are entered, the next setting turns the Backlight ON or OFF.

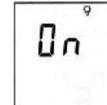

To change the settings, press the arrow button.



If the unit detects no key press for 2 seconds in the Setting screen, it moves to the next setting.

Pressing the ON/OFF button, after you have entered the desired setting, will save the setting and move the screen to the next setting.

Auto Off Time Settings:

When Auto Off is set, the unit will shut down automatically at a specified time between 1 and 6 minutes, if there is no key press detected within the set time.

For example, if the Auto Off time is set as 1, then the unit will automatically shut down after a minute when no key is pressed.



The duration will change based on the set time of 1 - 6 minutes.

If the Auto Off time is set to be "0", then the unit will not automatically turn off. A user must turn it off by pressing and holding the ON/OFF button for 5 seconds.

Turn off time can be set by pressing arrow button and can be saved by pressing the ON/OFF button.

After you save this setting the unit will exit to the measurement screen.

Battery Low Indication:

Whenever the battery is low there will appear a battery low indication symbol on the screen (bottom right). This indicates that the battery is low and should be replaced soon. The unit will continue to perform in battery condition within the specified accuracy and turns off when the battery reaches the limit.



Holding/Freezing the Reading:

While measuring, if the reading needs to be frozen for any observation, press the ON/OFF button during measurement. A text "HOLD" will be displayed on the screen.



8. Battery Replacement

A 550mAh battery will last continuously for more than 20 hours for a DigitalMini in operation. A Battery Low indication on the screen indicates that the battery needs to be changed in a short time.

Remove the screw assembled to fix the battery lid on the back side of the unit.

Slide the battery lid downwards, applying a little pressure with the thumb to open the battery compartment.

Remove the battery and replace. Care must be taken to ensure that the polarity is correct. Place the battery inside the compartment.

9. Technical Specifications

Operating Conditions:

Operating temperature range: 0°C to 50°C

Humidity: 0 to 90%RH, non-condensing

Measurement Specifications:

Moisture Measurement:

For integrated and remote pin probes:

Strong and reliable integrated pins with a cap to protect.

Pin measurement range (%mc in wood/%WME) - 7.9 to 99% (readings over 30% are relative).

10 Physical Specifications

Power:

9V Alkaline 550mAh, Battery Low indication on LCD

Size:

19 x 6.5 x 3.5cm (7.5 x 2.5 x 1.4")

Gross Weight (without battery)

~228g

Maximum Needle Depth

For WME pins: 10mm (0.4")

Buzzer

Audible buzzer for key tone and measurement indication, user configurable.

Regulatory Compliance

CE, RoHS, ETL