



Nothing else measures up!

Follow us!



Prospect House
George Cayley Drive
Clifton Moor
York
England
YO30 4XE

Tel: +44 (0) 1904 692723
Fax: +44 (0) 1904 690385

E-Mail: sales@yorksurvey.co.uk




Winkeltronic Easy



Operating Instructions

Winkeltronic Easy

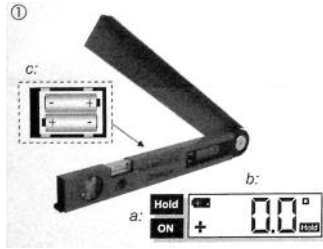


a: Control buttons

ON On/off button; reset button when on Hold
 HOLD Keep measurement in display

b: Display

Angle in degrees, with sign
 Upper left: Symbol for low battery
 Lower right: Symbol for activated HOLD key

c: Battery compartment (rear): Install batteries in proper position!

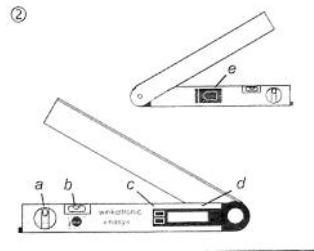

a: Vertical bubble level: Measures angle from vertical.

b: Horizontal bubble level: Measures angle from horizontal.

c: Buttons

d: Display

e: Battery compartment: To open, push cover in direction of arrow.



WARNING

Danger of pinching hand and fingers



WARNING

Do not touch any live parts. Housing conducts electricity



NOTE

To measure absolute angles, first close instrument all the way and then turn on.

Special Functions



A - To measure **absolute angle**, turn on in folded position.



B - To measure **relative angle**, turn on in any position.



C - To **keep measurement**, press HOLD button. Measurement in display blinks. To terminate Hold function, press ON.



D - To measure **opposite angle**: Press HOLD and ON at the same time. Degree symbol [°] blinks.



E - To turn on for **continuous measurement**: Press ON for more than 5 sec. "ON" appears briefly in display.



Contact surfaces must be clean.

Dirt can cause measurement errors.

Inspect Winkeltronic Easy regularly for damage and check function.

Check horizontal and vertical levels (Fig. 2, b) regularly by turning over.

If battery symbol appears (Fig. 1, b), batteries (Fig. 1, c) must be replaced.

Measurement range:	200°
Display graduations:	0.1°
Accuracy:	±0.2°
Power supply:	2 batteries (1.5v - type LR6 (AA))
Operating time:	approx. 200h
Automatic switch-off:	after 5min
Operating temperature:	0°C to +40°C
Storage temperature:	-20°C to +70°C

Remove dirt with a soft, moist cloth.

Do not use any strong solvents.

Winkeltronic Easy does not require calibration. Instrument is ready for use after insertion of batteries.

Protect against moisture and humidity.